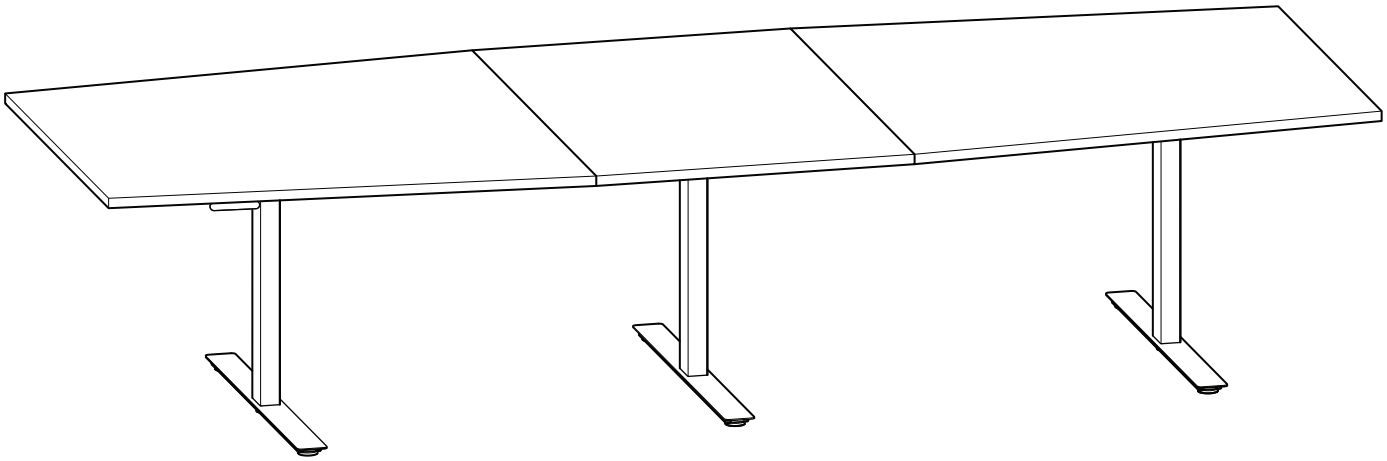
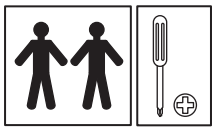
Electric height adjustable table
Assembly instructions

Conference table

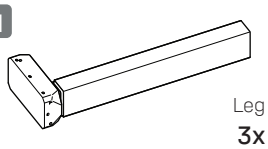

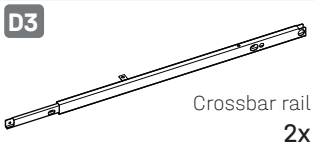
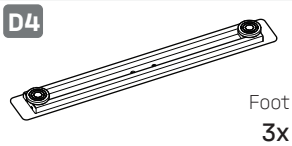




AJ-A-0988
V1.2 2024-03-05











PACKAGE CONTENTS **(3-LEG TABLE)**




DESK COMPONENTS

D1  Leg 3x	D2  Side bracket 3x	D3  Crossbar rail 2x	D4  Foot 3x
D8  Crossbar rail (Addon leg) 2x	D9  Addon bracket 1x		


HARDWARE


H1  M6x12 18x	H2  M6x10 4x	H3  Screw clamp 4x	H4  Screw guide bush 4x	H5  M8x14 6x	H6  2mm rubber 8x	H7  5mm rubber 4x
H8  Tapping screw 5x20 26x	H9  Tapping screw 5x16 2x	H10  Control box 1x	H11  Handset 1x	H12  Power cable 1x	H13  Leg cable (short) 1x	H14  Leg cable (long) 1x
T1  Hex key 1x						

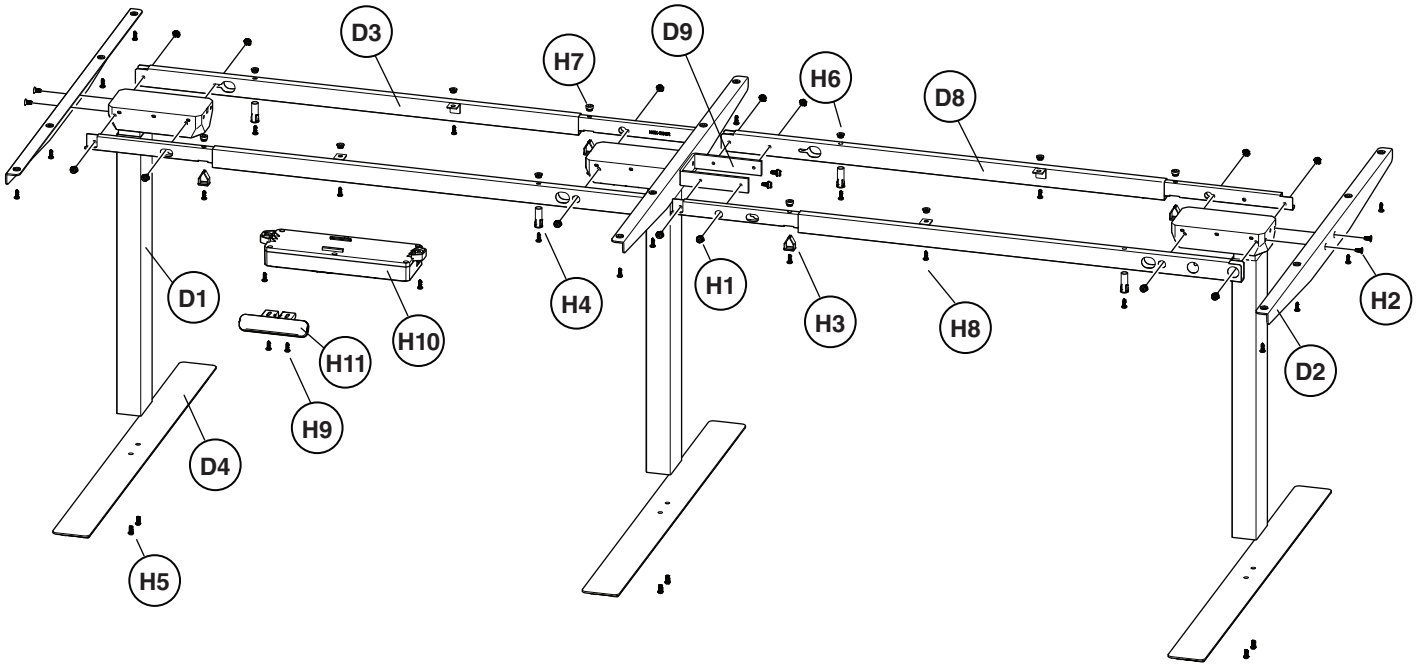Note: There may be additional hardware included in the package, as these are used for different desk configurations.




1

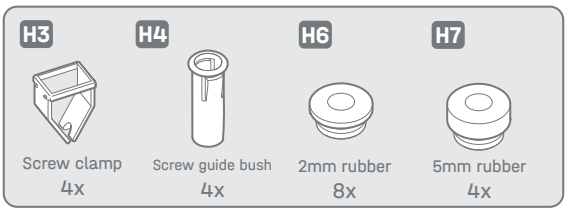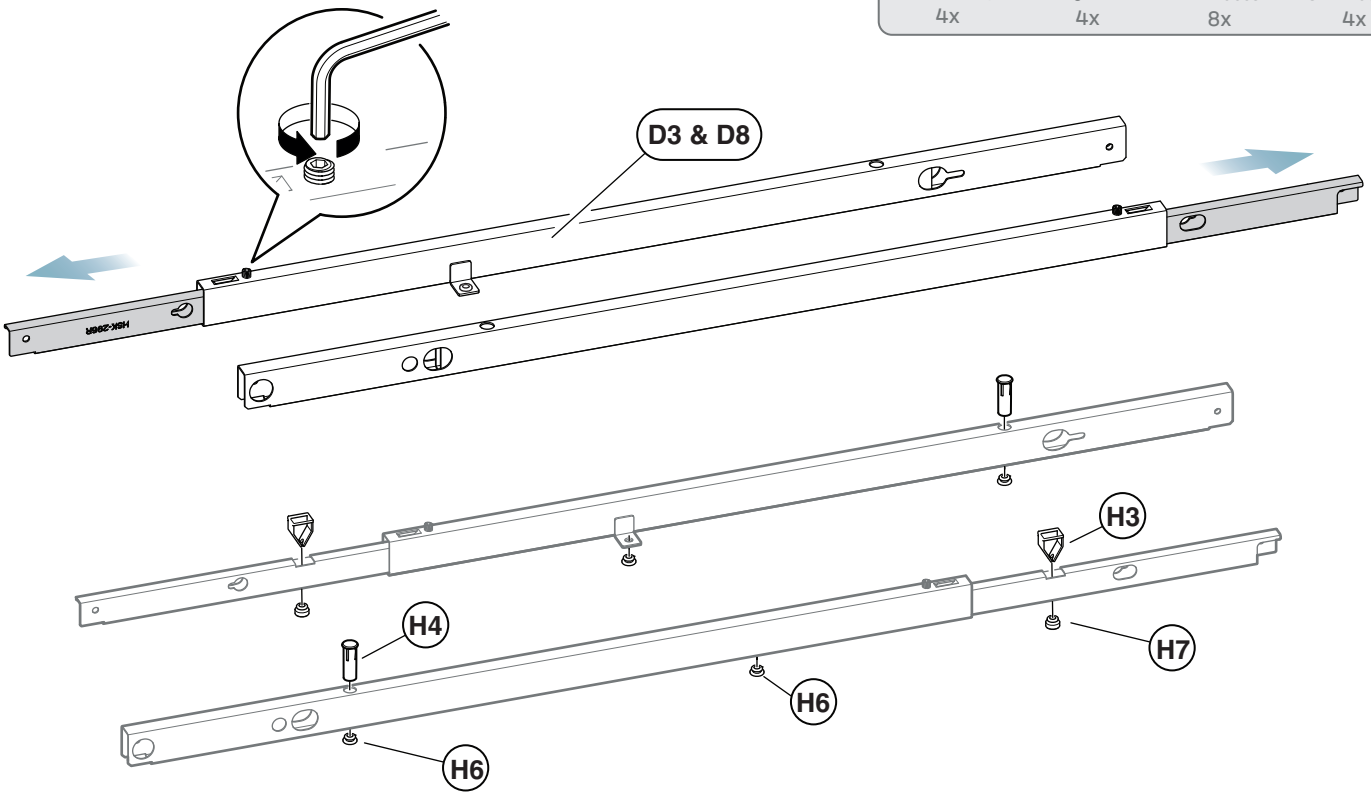
H3
Screw clamp
4x
H4
Screw guide bush
4x
H6
2mm rubber
8x
H7
5mm rubber
4x


D3 & D8
H3
H4
H7
H6
H6

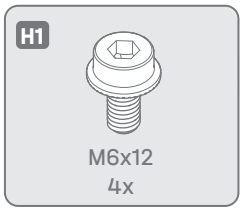2



H1
M6x12
4x

H1
D3
D1

3

H1

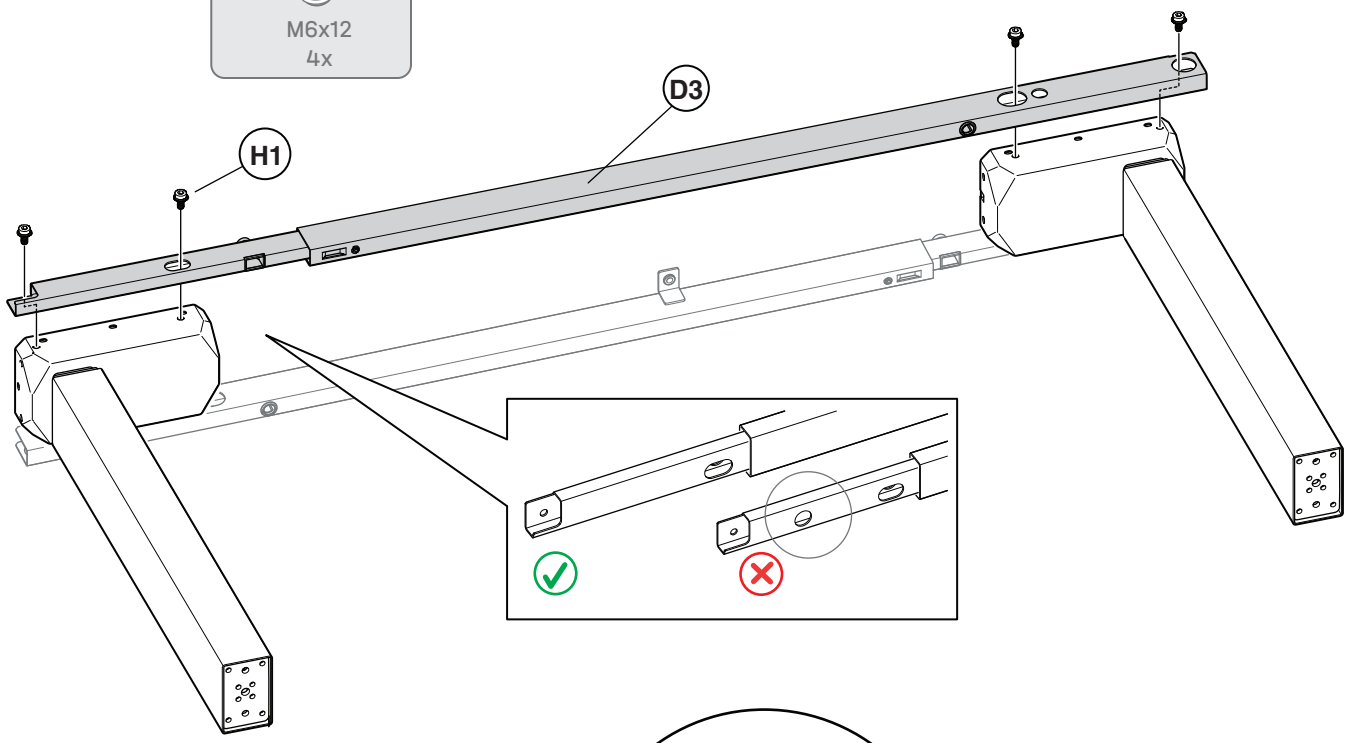
M6x12
4x




4

H5

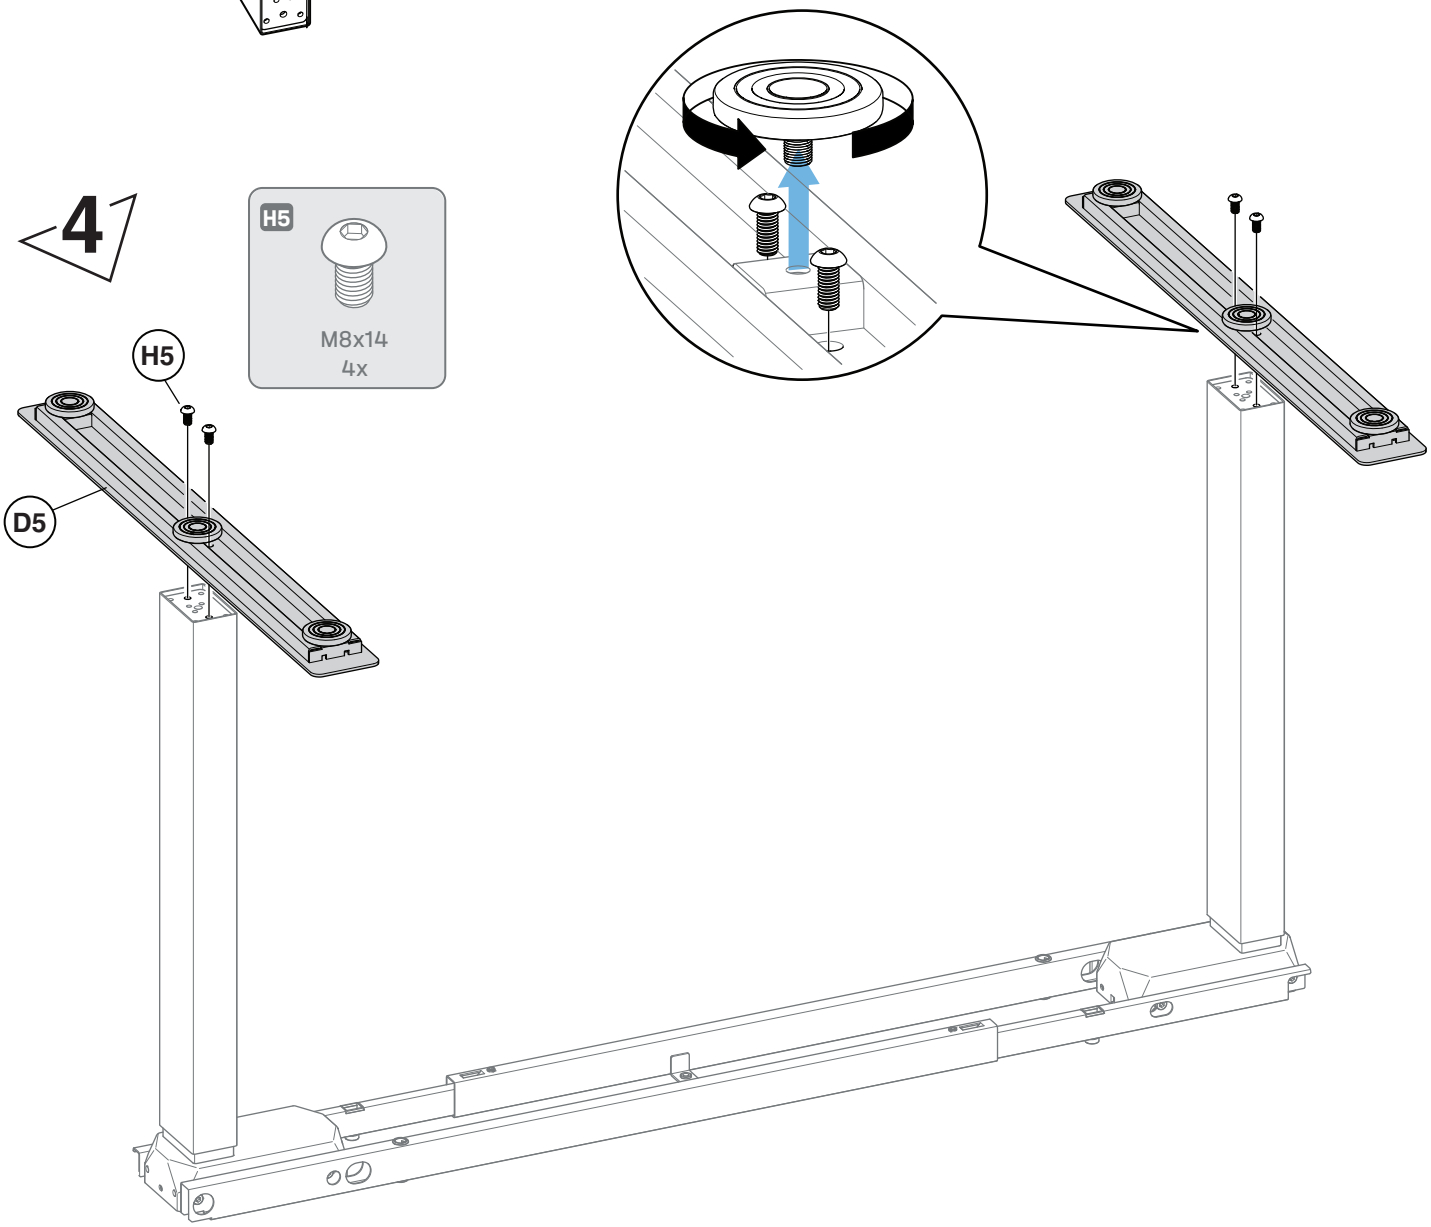
M8x14
4x




5

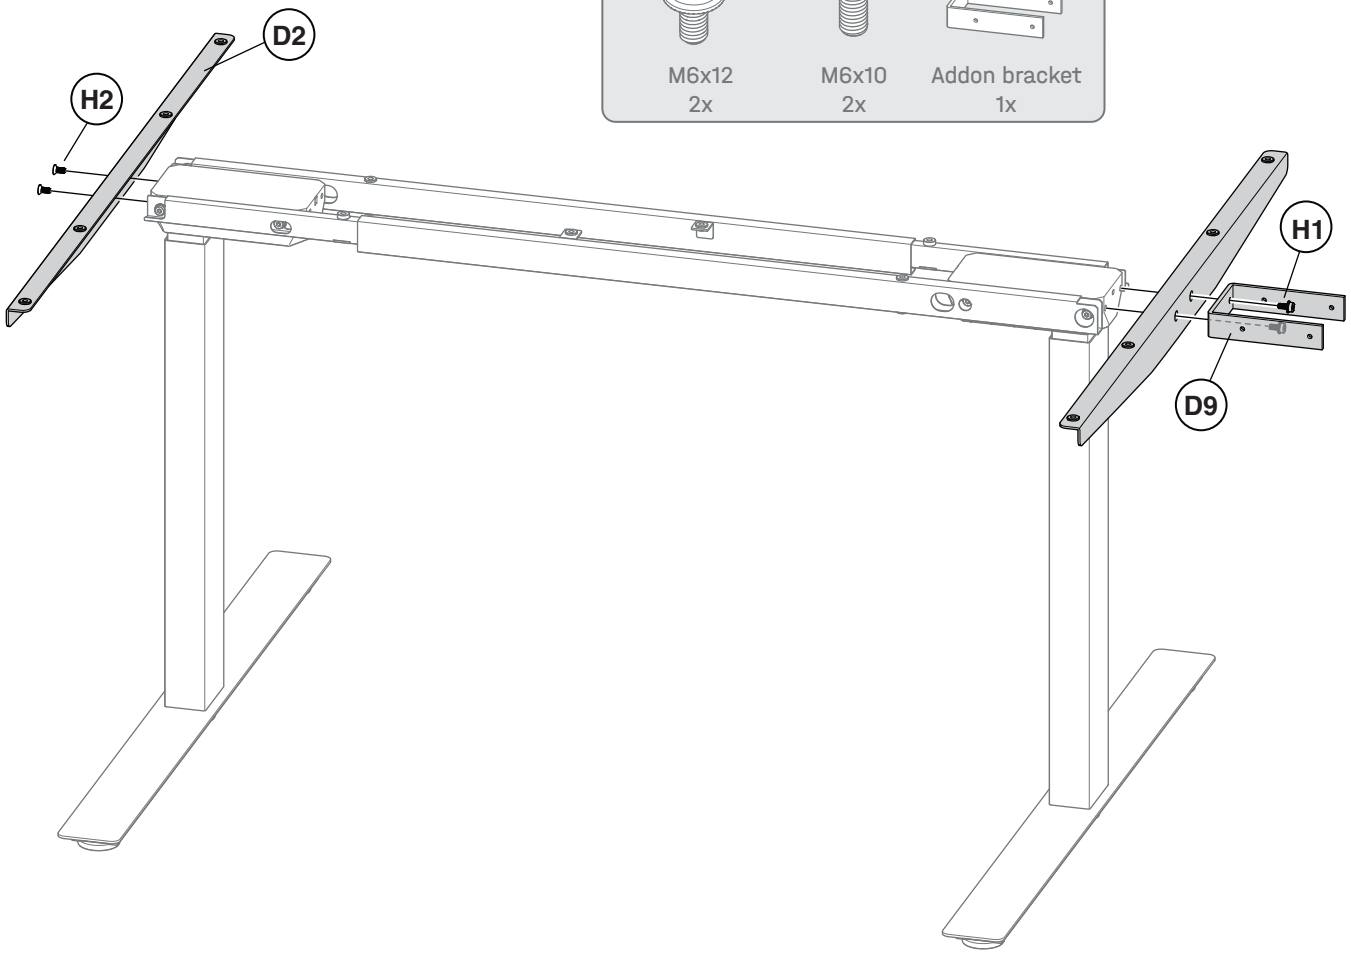
H1
H2
D9
M6x12
2x
M6x10
2x
Addon bracket
1x
D2
H2
H1
D9

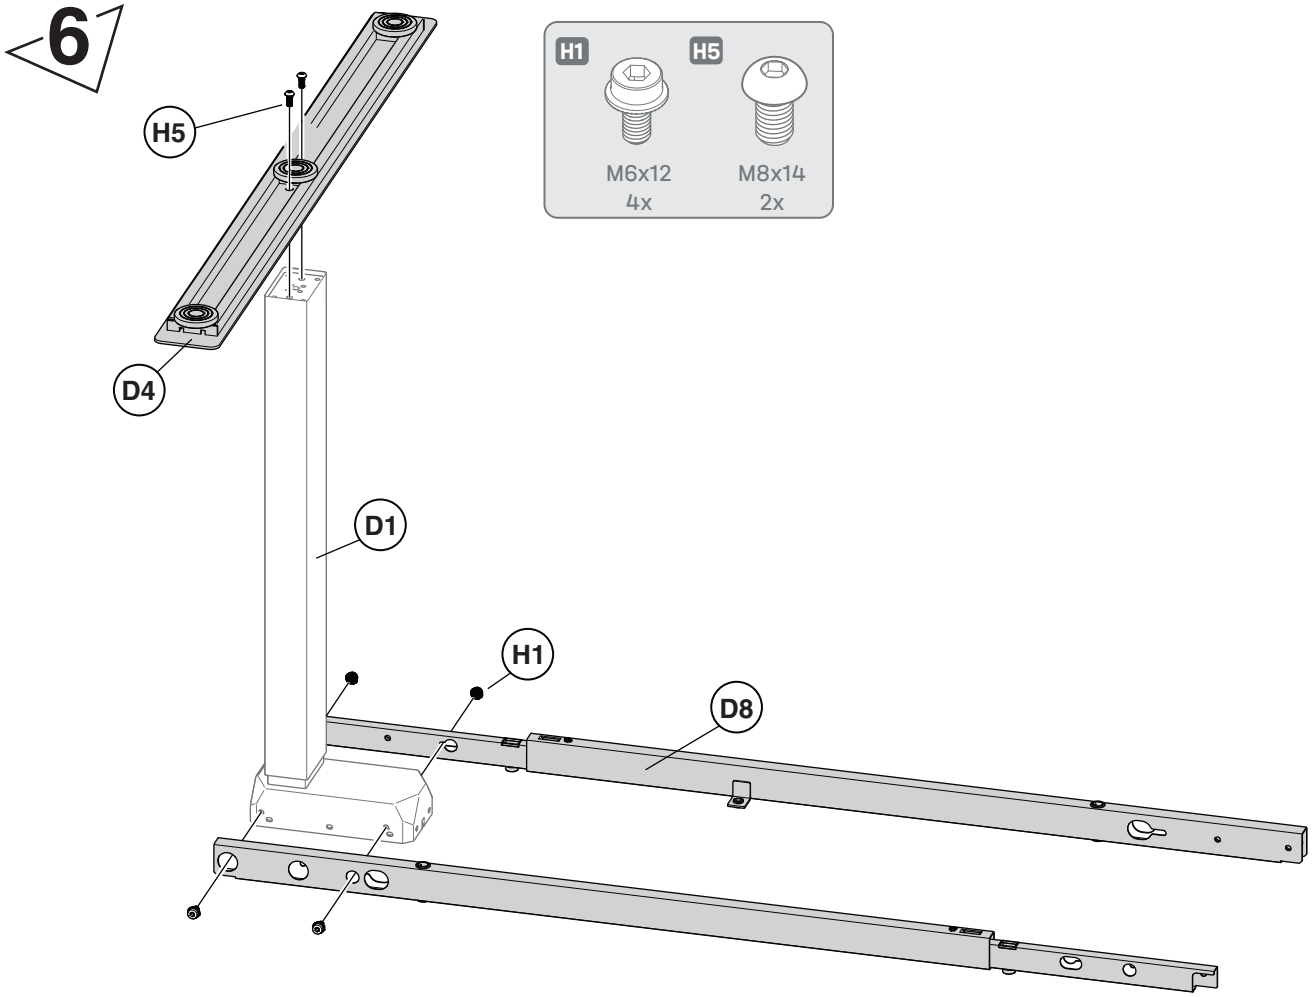6


H1
H5
M6x12
4x
M8x14
2x
H5
D4
D1
H1
D8

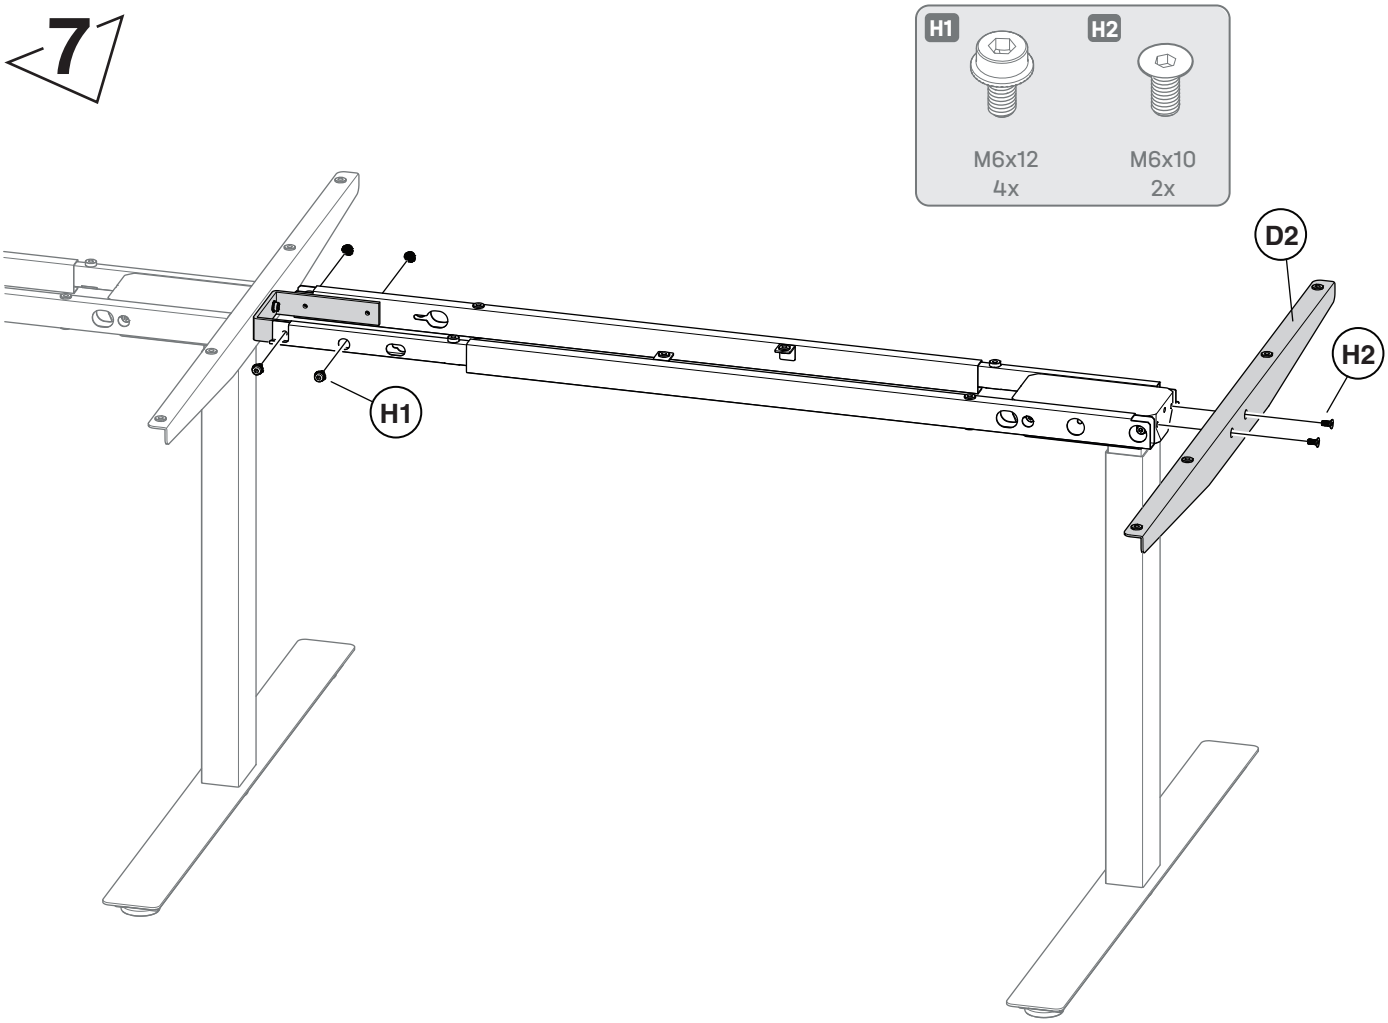7



8

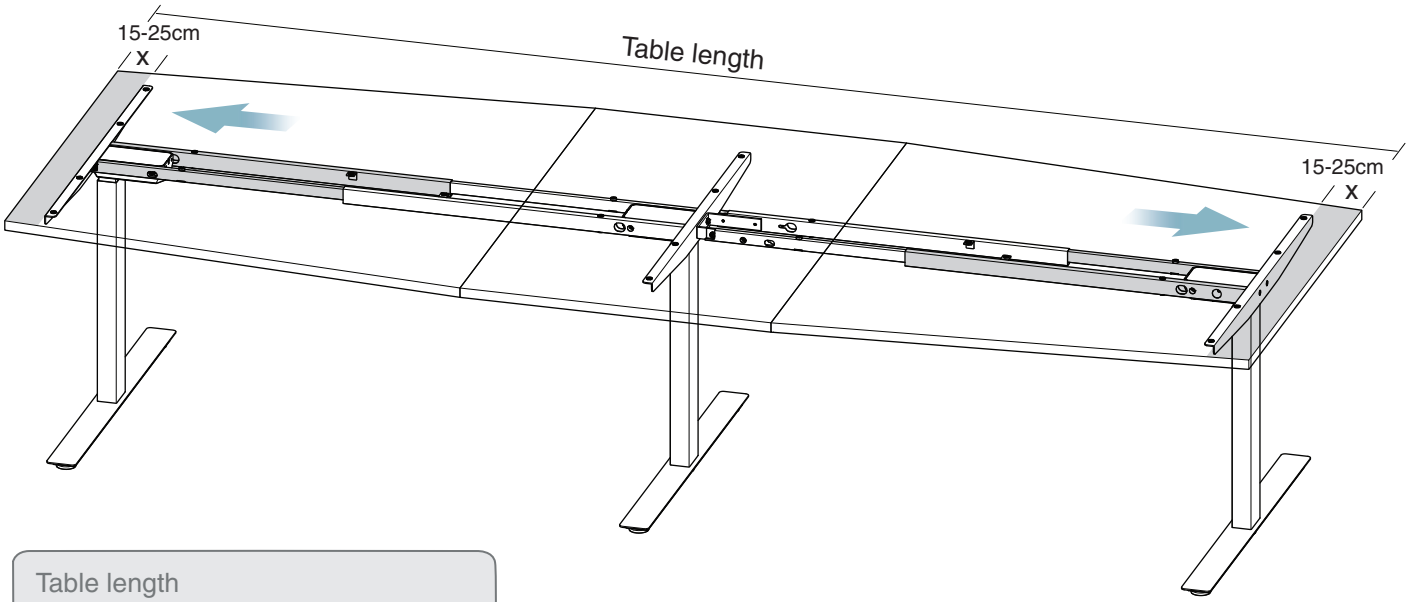


Table length	
3200 mm (3-leg)	X = 150 mm
4000 mm (3-leg)	X = 250 mm

Leg placement guide



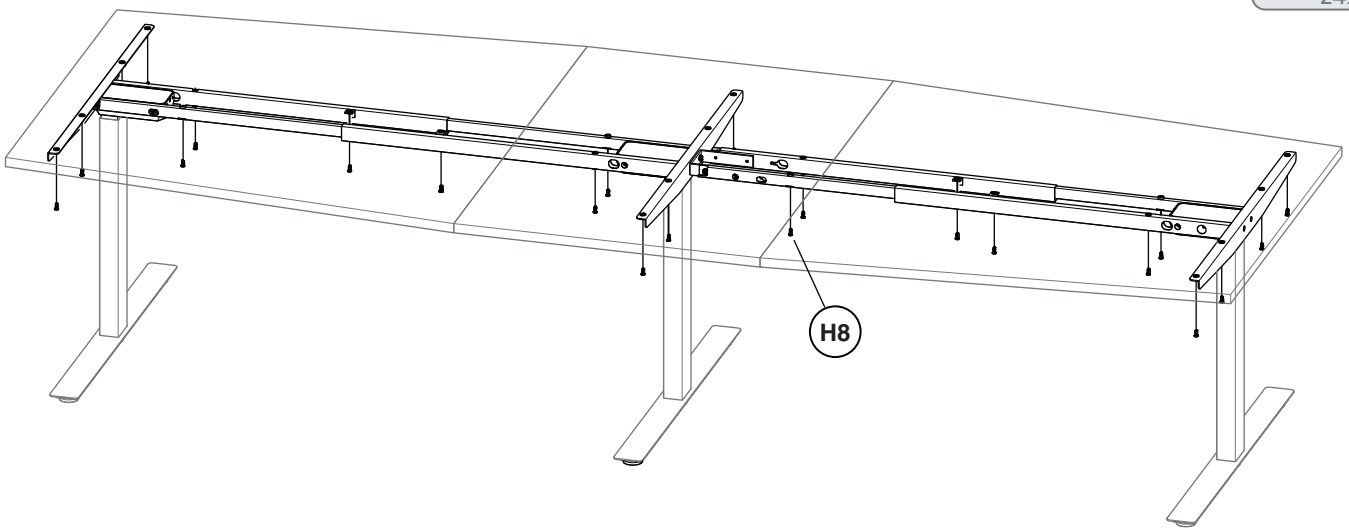
9

H8




Tapping screw 5x20

24x



10

H10



Control box

1x

H8



Tapping screw 5x20

2x

H11



Handset

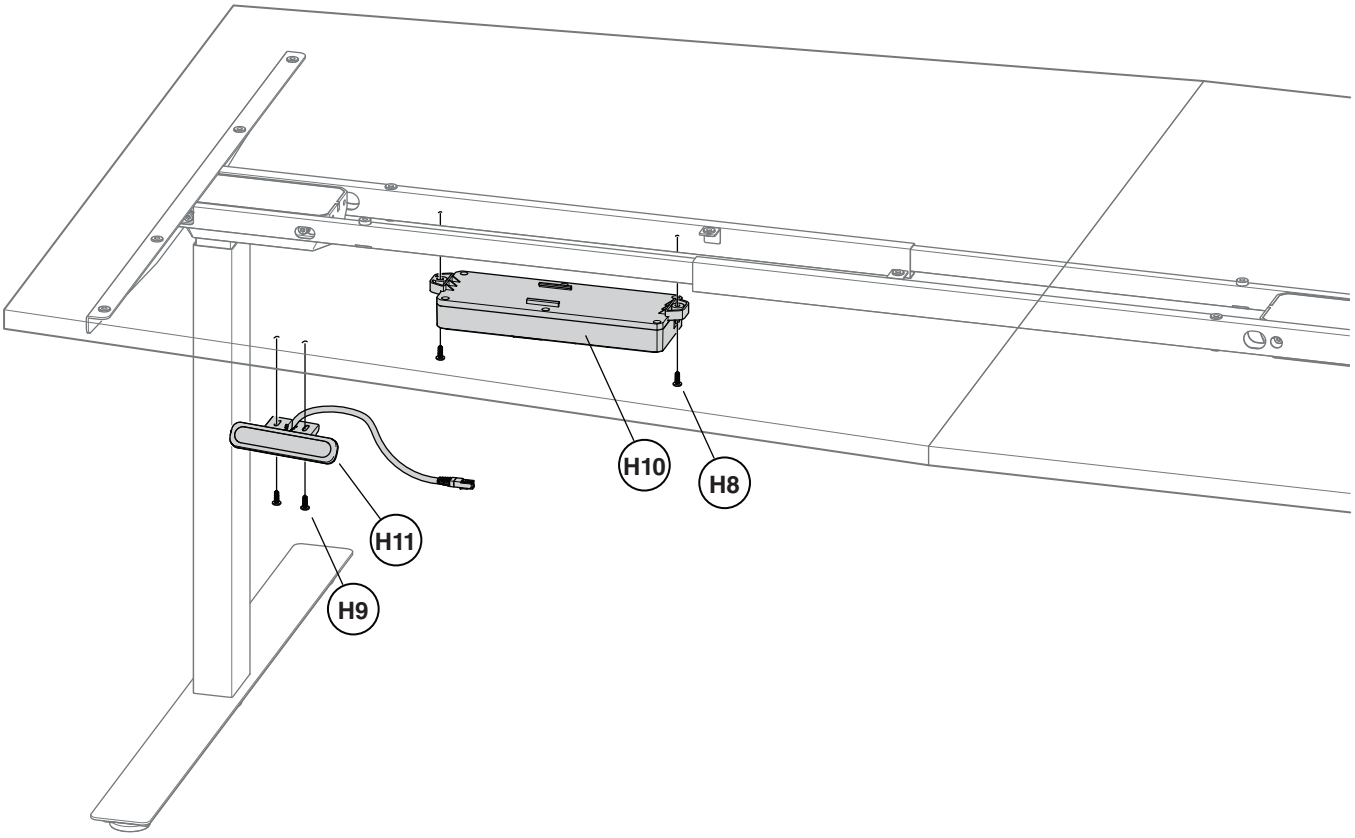
1x

H9





Tapping screw 5x16


2x



11

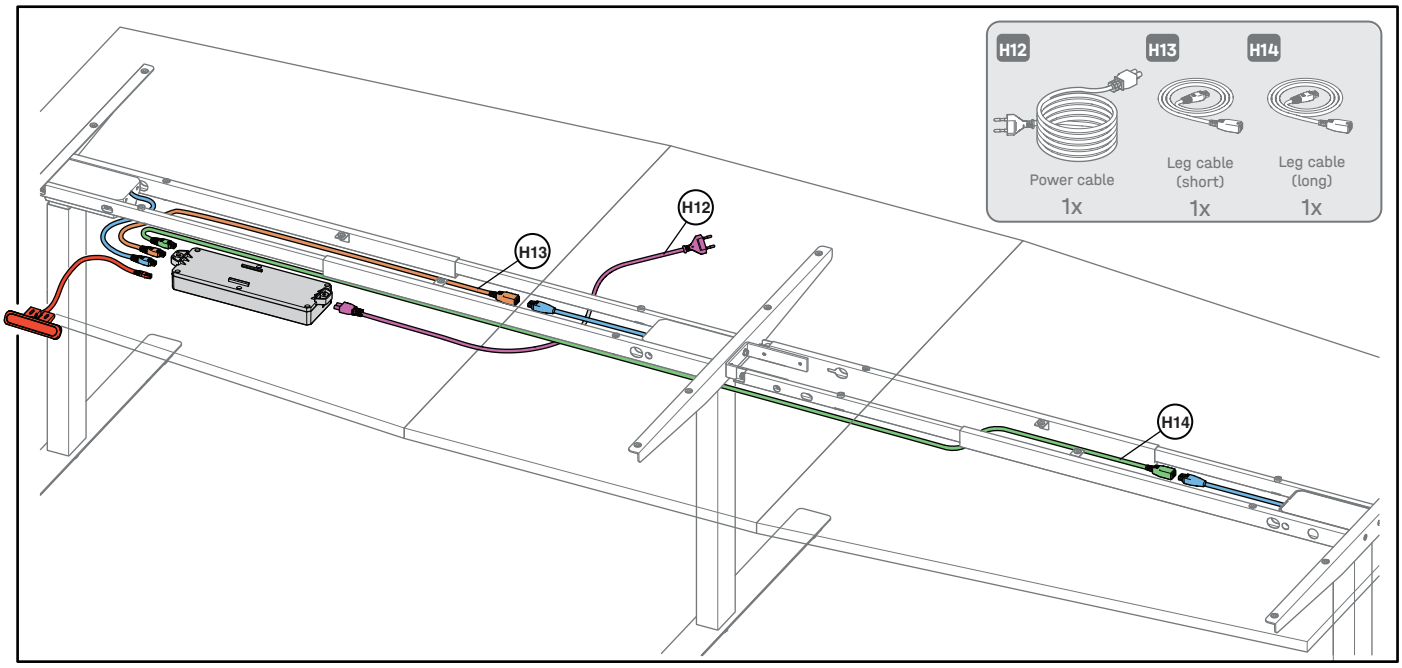

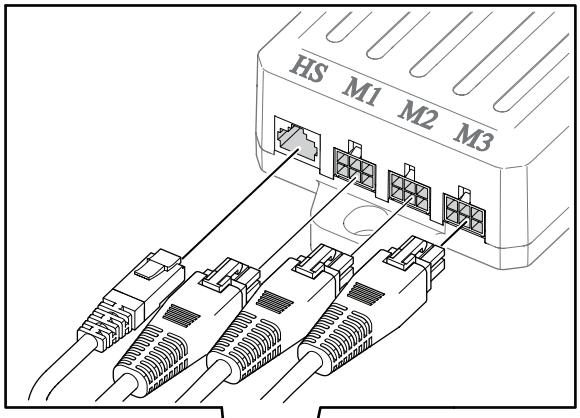


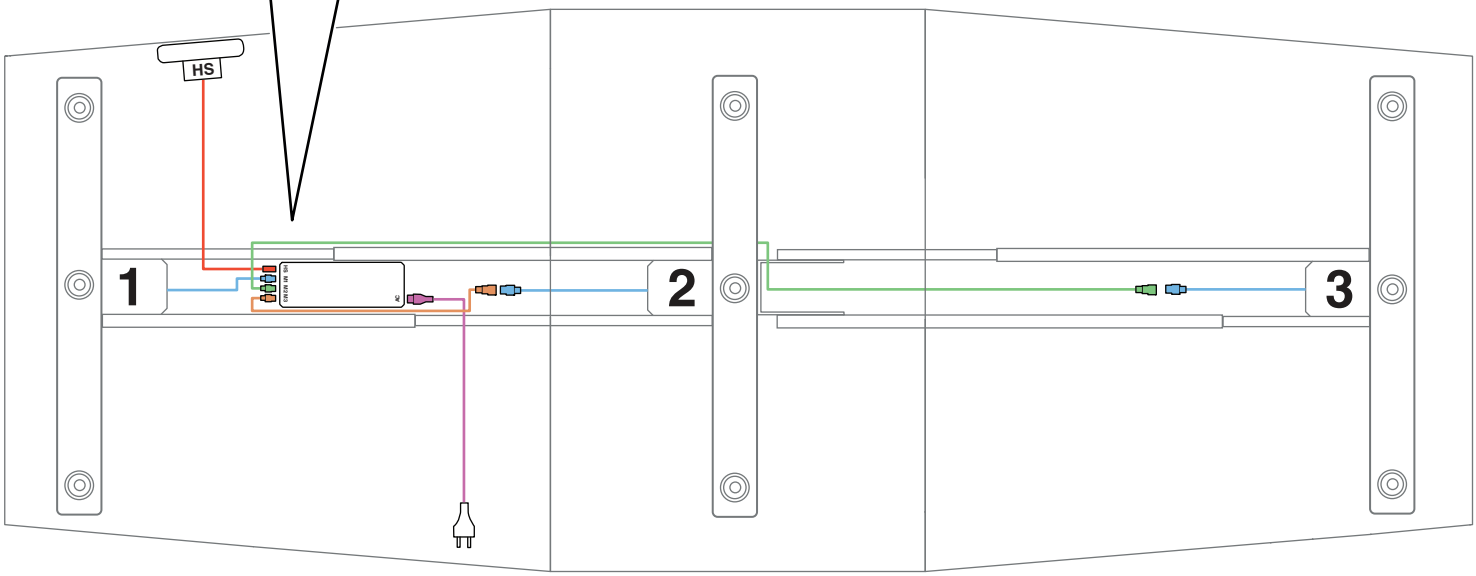


Underside view

LEG PLACEMENT GUIDE

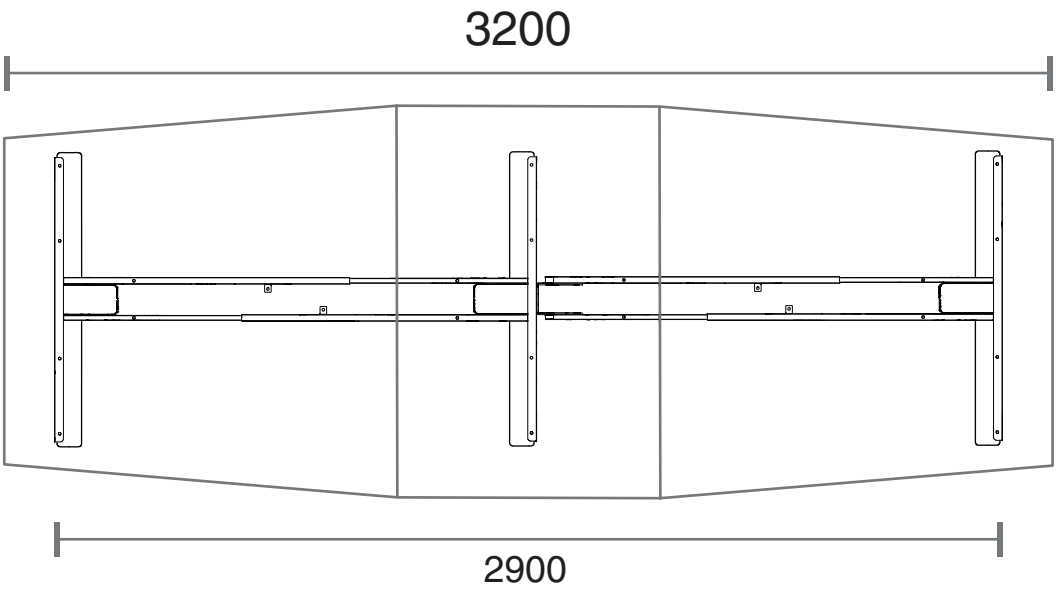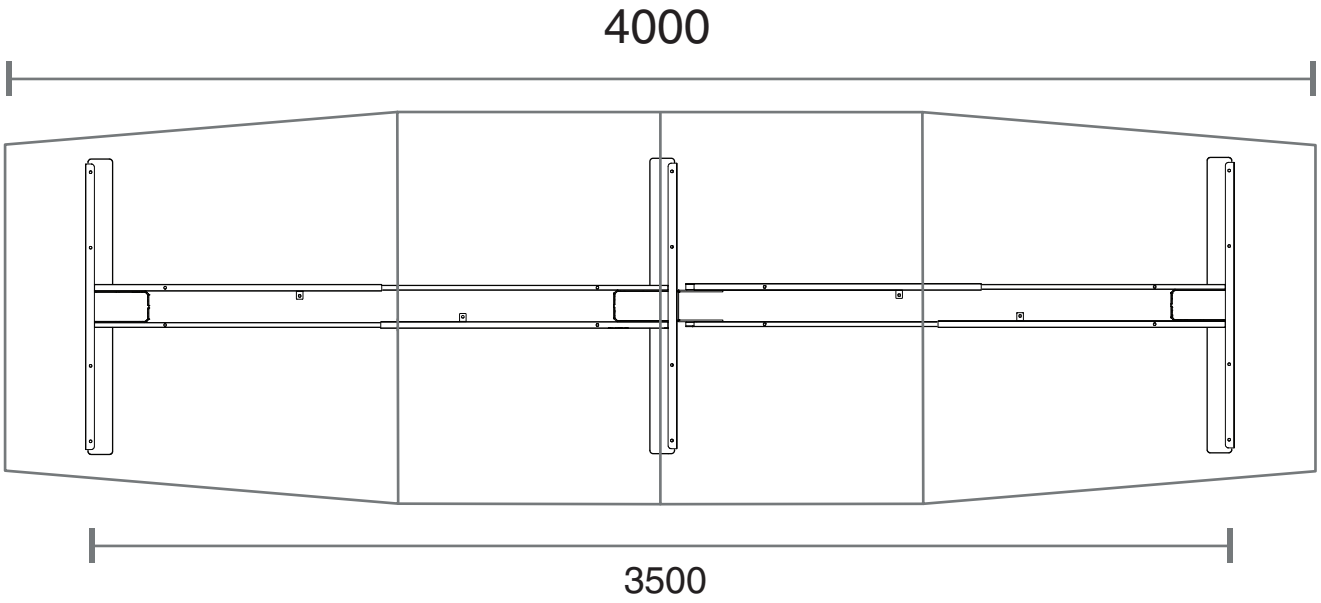TOP VIEW





Assembly instructions - 3 leg conference table

English

Step 1

The crossbar rails (D3 & D8) are compressed when delivered.
1. Loosen the set screws slightly and extend the inner rail.
2. Attach rubber bushing (H6) and plastic screw guide bushing (H4) on the **thicker** part of the crossbar rail.
3. Install rubber bushing (H7) and triangular screw clamp (H3) on the **thinner** side of the crossbar rail.
4. Repeat step 1-4 for all crossbar rails (D3 & D8).

Step 2

1. Take the corner leg (D7) and one leg (D1) and lay them on a flat surface.
2. Place a crossbar rail (D3) across the legs, ensuring the rubber bushings face upwards towards the table top.
3. Attach the crossbar to the leg with four M6×12 screws (H1).

Step 3

1. Flip the assembly and place the second crossbar rail (D3), install with four M6×12 screws (H1).

Step 4

1. Install the the feets by using four M8×14 screws (H5). Unscrew the middle plastic feet guide to reveal the mounting holes. Install the feet guide again after tightening the screws.

Step 5

1. Install one side bracket together with the Addon bracket (D9) using two M6×12 screws (H1).
2. Install the remaining side bracket with two M6×10 screws (H2).

Step 6

1. Take the remaining leg (D1) and install the addon crossbar rails (D8), using four M6×12 screws (H1).
2. Install the feet by using two M8×14 screws (H5).

Step 7

1. Install the addon leg assembly to the frame by using four M6×12 screws (H1) on the addon bracket.
2. Install the remaining side bracket to the addon leg assembly, using two M6×10 screws (H2).

Step 8

1. Adjust the width of the frame assembly by moving the legs closer together or farther apart.
2. Make sure there is approx. 15cm cm gap between the frame and the edge of the table top for table width 3200mm, and approx. 25cm gap for 4000mm table width.
3. Tighten all the set screws on the crossbar rails.

AJ-A-0988-1
V1.1 2024-03-05

Assembly instructions - 3 leg conference table

English

Step 9

1. Fix the tabletops to the frame, using the included tapping screws 5×20mm (H8).

Step 10

1. Use two tapping screws 5×20 (H8) to fix the control box (H10). Place it between the two crossbars, near one of the legs so the leg cable have sufficient length to the control box.
2. Use two 5×16 screws (H9) to fix handset (H11).

Step 11

3. Connect the handset (H11) into the control box (H10) in port labeled **"HS"**.
4. Connect the leg cable which is nearest to the control box in port labeled **"M1"**.
5. Connect the middle leg with the included extension leg cable (H13), and then into port labeled **"M2"** on the control box.
6. Connect the leg (addon leg) furthest away from the control box with the included extension leg cable (H14), and then into port labeled **"M3"** on the control box.
7. Plug the power cable (H12) into port labeled **"AC"** on the control box. Plug your desk into a electrical outlet.

Note! Before using your desk, a desk reset is required. See chapter 1 in your user manual for the handset.